

TG700
TV Signal Generator Platform
Release Notes

www.tektronix.com



077-0228-03

Tektronix

Copyright © Tektronix. All rights reserved. Licensed software products are owned by Tektronix or its subsidiaries or suppliers, and are protected by national copyright laws and international treaty provisions.

Tektronix products are covered by U.S. and foreign patents, issued and pending. Information in this publication supersedes that in all previously published material. Specifications and price change privileges reserved.

TEKTRONIX and TEK are registered trademarks of Tektronix, Inc.

Contacting Tektronix

Tektronix, Inc.
14200 SW Karl Braun Drive
P.O. Box 500
Beaverton, OR 97077
USA

For product information, sales, service, and technical support:

- In North America, call 1-800-833-9200.
- Worldwide, visit www.tektronix.com to find contacts in your area.

Table of Contents

Release Notes	1
New Features.....	1
General Limitations.....	2

Table of Contents

Release Notes

This document describes new features, improvements, and limitations of firmware version 5.4 for the TG700 TV Signal Generator Platform.

New Features

This release adds a new genlock function for the GPS7 GPS Synchronization and Timecode Module.

Genlock functions are only available for GPS7 modules with a connector labeled BLACK 1 / REF IN on the rear panel. That same connector in older modules is labeled BLACK 1. (See Figure 1.)

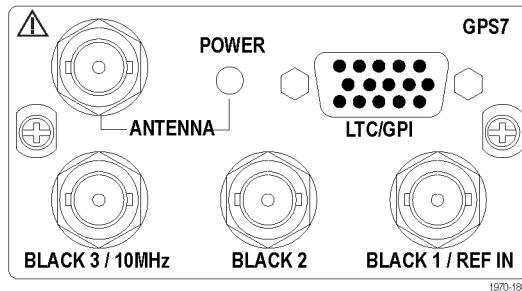


Figure 1: Rear panel of modules with genlock functionality

GPS7 Module

The GPS7 module now supports the following new features:

- User-selectable genlock mode for video reference. NTSC and PAL black burst signals, and HD tri-level sync signals are supported for the reference input.
- Stay Genlock™ mode for the genlock input.
- VITC reader on the reference input for time reference.
- Alarm outputs on the General Purpose Interface for loss of genlock errors.

General Limitations

This release has the following general limitations:

TG700 Mainframe Requirements for this Release

Firmware release version 5.4 must be installed on a TG700 mainframe with at least 32 MB of memory. A 16 MB system can be upgraded to 64 MB by ordering the FP (Frame Picture) upgrade kit. (Tektronix part number 040-1698-xx).

TG7 Setup Software

In setting signal formats for the Black 2 and Black 3 outputs of the AGL7 module, do not select Black 2 = HD sync (same as Black 3) and Black 3 = BB (same as Black 2) simultaneously, while Frame Reset 1 is set to 2.997 Hz. This operation makes the Frame Reset 1 unstable. If this is the case, reset the system by recalling the Power On Default setting or a preset.

TG7 Comm Software

Do not change or delete any file names or folder names other than those downloaded by users (signal files, sequence files, and preset files). Doing so can cause the instrument to operate in an unexpected manner.

You can change the names of user files (signal files, sequence files, and preset files) after you have downloaded them into the TG700 mainframe. Remove and reapply power to see the updated names on the mainframe.

Resetting an Output Signal

When the instrument rereads or resets signal data, such as format changing, preset recall, or signal-button assignment, a signal output interruption or synchronization shock may occur.

Setting the Genlock Source

If you change the frame reset period in the AGL7 module after the genlock source is set to CW, the frame reset may not be selected properly. If this is the case, set the frame reset to CW.

Assigning a Signal and Frame Picture to a Front-Panel Button

When you assign a downloaded signal to a front-panel button, do not assign different format signals to the same button.

Do not assign a signal set to a signal button of the signal that is currently being output. Also, do not assign a signal set to a signal button while the message “No Signal Set Assigned” is displayed. If you reassign a signal set to the OTHER button, perform the reassignment while a signal that is assigned to a button other than the OTHER button is output.

Embedded Audio Samples for 3G-SDI Formats

When using the HD3G7 module with exactly three groups of embedded audio, audio data from the same sample period may sometimes be split into adjacent lines. This behavior only happens with formats with a field or frame rate of 29.97 or 30 Hz, and not with formats with a field or frame rate of 23.98, 24, 25, 50, 59.94, or 60 Hz. Use one, two, or four groups of embedded audio to force audio sample data for all groups to be located on the same line.

Embedded Audio of the HDVG7 Module

- Embedded audio for 720 23.98p/24p formats are not supported for the HDVG7 module, even though they can be selected in the menus.
- The first user data word in the audio control packet (containing the Audio Frame value) has incorrect parity when the frame count is 1, 2, or 4.

Pulse and Bar Test Signal for 3G-SDI Formats

The pulse and bar test signal for the HD3G7 module is labelled *2T60 Pulse and Bar* for all formats, but the signal is actually a 2T30 Pulse and Bar for formats with field or frame rates of 30 Hz or less. The signal is 2T60 only for 1080p 50/59.94/60 Hz formats.

Y to GBR Convertor Mode of the HDLG7 Module

If the output format is 2K and the Converter mode is set to Y to GBR, changing operating mode by selecting a test signal will cause an unexpected black and white signal to be generated. To correct the test signal, press the OTHER button until Normal is selected, and then press the test signal button.

25/29.97/30 Hz Segmented Frame Format for the HDLG7 Module

The HDLG7 module does not have format selections for 1080PsF at 25 Hz, 29.97 Hz, or 30 Hz. These formats are almost identical to 1080i (interlaced) formats at 50 Hz, 59.94 Hz, and 60 Hz respectively; these format settings can be used with progressive segmented signals. However, note that the SMPTE 352M payload identifier for the output signal will show an interlaced signal format, even when the HDLG7 module is converting a single link progressive segmented input signal to dual link.

Multiple Timecode Formats

Frequent changes to output formats can result in instability on those outputs. Disturbances to PAL output signals can be prevented by setting any output to PAL as a power-on preset, and then keeping any output set to PAL at all times.

Converter Mode of the HD3G7 Module

- Infrequently, the module will fail to up-convert the input HD-SDI signal. If no output is seen, the problem can be corrected by selecting a different test signal and then switching back to converter mode.
- The trigger output cannot generate a frame pulse or line pulse when the module is in converter mode.
- The moving picture and video component functions do not apply to up-converted output signals.

Embedded Audio of the HD3G7 Module in Converter Mode

When a Level B format is selected for the up-converted 3 Gb/s output signal, embedded audio from the input HD-SDI signal will be copied into both virtual links. Therefore, up to 32 channels of embedded audio can appear on the 3 Gb/s output.

Time of Day Changes For Timecode Outputs

When the time-of-day changes, such as when scheduled daylight savings adjustments are made or when the internal time is set from the front panel, there can be a delay before that change is reflected on timecode outputs.

This delay may be a small number of frames (fraction of a second) when all timecode output formats are based on the same clock rate (for example, NTSC black burst and 1080i 59.94 HD trilevel on black outputs in addition to 30 fps drop-frame on LTC outputs), or up to several seconds when timecode formats based on different clock rates are used (for example, 29.97 fps and 24 fps on different outputs).

General Purpose Interface for the GPS7 Module

When the GPS7 module is in genlock mode, the Near Loss-of-Lock alarm output for the GPI does not assert until very close to the full Loss-of-Lock condition.

Closed Caption Data with the HD3G7 Module in Converter Mode

- The HD3G7 module does not re-format SMPTE 334 Caption Distribution Packets in converter mode. Therefore, when up-converting from 1080i 59.94 Hz to 1080p 59.94 Hz, for example, the output will contain CDP data in alternate frames, each with 40 bytes of caption data, instead of CDP data in every frame, each with 20 bytes of caption data.
- Up-conversion to a Level B fast progressive format may result in mis-ordered Caption Distribution Packets in the stream of output frames.

SDI Equalizer Test Signal of the HD3G7 Module

Per SMPTE RP198 for HD-SDI, a polarity change word is used to ensure equal probabilities of the dc bias for the equalizer test pattern. However, some 3G SDI formats still exhibit an unequal bias. Enabling a dynamic bit stream in the output signal, such as embedded audio or timecode data, will result in both dc levels appearing in the output signal.